



TECHNICAL DATA SHEET

2400 Boston Street | Suite 200 | Baltimore, MD | 21224

DAP® Latex Window Glazing

PRODUCT DESCRIPTION

DAP® Latex Window Glazing is a ready-to-use glazing compound that may be used for face glazing single pane glass in wood or metal window frames. Its nozzle allows for smooth, easy application. DAP Latex Glazing sticks tightly to glass and sash and resists sagging, cracking, shrinking and chalking.



PACKAGING	COLOUR	SKU	UPC
300mL	White	7079870980	0 707987097 8

KEY FEATURES & BENEFITS

- For Face Glazing Wood and Metal Windows
- Weathertight, Durable Seal
- Resists Sagging, Cracking and Shrinking
- No Painting Needed
- Easy Water Clean-Up
- Easy-to-Use Nozzle
- Interior/Exterior Use

SUGGESTED USES

Ideal for face glazing single pane glass in wood, steel, or aluminum window frames.

NOTE: Do not use DAP Latex Window Glazing on plastic windowpanes, porcelainized steel insulating panels, insulated glass units with an organic seal, stained or leaded glass, any windowpane over 1.2 meters in any run direction, any metal sash with rabbets over 2.5 cm (1 inch) wide, channel glazing or on any surface not prepared as set forth below.



TECHNICAL DATA SHEET

2400 Boston Street | Suite 200 | Baltimore, MD | 21224

APPLICATION

Surface Preparation

1. When re-glazing, remove from sash all: (i) old glazing compound, (ii) any glazier points and/or spring clips, (iii) glass, and (iv) any back bedding. Surfaces must be clean, dry, structurally sound & free of all foreign material, including any substance that would compromise adhesion of the glazing material (e.g., wax, oil, grease, rust inhibitors, silicone residue, etc.).
2. Remove nozzle and cut cartridge nub.
3. Re-attach nozzle and cut tip at 45° angle to desired bead size. Load cartridge into caulking gun.
4. **For metal windows:** sash corners must be sealed. All sashes must be safely installed and adjusted prior to glazing and sufficiently rigid to permit normal operation without excessive bending or flexing. Adjustment of freshly glazed sash will disrupt the adhesive bond of the glazing material to the glass and sash.
5. **For wood:** sash applications, prime sash with an oil-based primer only and allow primer to dry.

Product Application

NOTE: Do not apply DAP Latex Window Glazing when air or sash temperatures are below 5°C or above 32°C. Do not apply during damp or rainy weather or if rain is forecasted within 24 hours of application.

1. Do not add any type of oil, pigment, thinners, solvents or additives to the glazing compound.
2. DAP Latex Window Glazing **must** be applied to backstop of sash to provide back bedding where glass is to be set. Minimum thickness of back bedding is 0.32 cm (1/8") throughout. **Only DAP Latex Window Glazing may be used for back bedding.** There should be no metal frame-to-glass or wood frame- to-glass contact.
3. For back bedding of metal sash, use spacer shims at quarter points to maintain 0.32 cm (1/8") minimum bedding thickness throughout.
4. Apply only DAP Latex Window glazing onto sash filling height and width of L-shaped recess completely.
5. Press glass firmly into place. If glass size is over 60 cm (24") in horizontal dimension, use setting blocks at quarter points on bottom rail. For clear glass, maintain 0.63 cm (1/4") minimum contact area between glass and compound throughout. For heat absorbing glass, 0.95 cm (3/8") minimum contact area is required throughout.
6. Install glazier's points (wood window frames) or spring clips (metal window frames) at quarter points of windowpane to hold glass. Space points/clips no more than 45.7 cm (18") apart for exterior glazed sash. For interior glazed sash, space them no more than 30 cm (12") apart. Points/clips are necessary to hold the glass in place. The glazing compound should not be expected to perform this function.
7. Apply face glazing to an angle that sheds water. There should be no gaps, spaces or indentations. Then shape corners to a rounded finish only. Thickly glazed sections may require tooling with an appropriate knife
8. Remove excess glazing with a damp cloth before it sets. If excess glazing needs to be removed after setting, such material must be cut, scraped away or otherwise mechanically removed.
9. Re-seal nozzle and store container in a cool, dry place away from extreme heat or cold.



TECHNICAL DATA SHEET


2400 Boston Street | Suite 200 | Baltimore, MD | 21224

Optional Product Painting

1. DAP Latex Window Glazing does not require painting. However, if painting is desired, the glazing may be painted only after it has completely dried.
2. When painting, use only (i) latex paint after 3 days or (ii) a high-quality exterior grade oil-based paint after 1 week. The paint line must overlap onto the face portion of the glass, as well as the bedding area where the sash and glass meet. For thickly glazed sections, more time should be allowed for complete curing. Due to the excellent weatherability of the product, painting can be delayed.

NOTE: The glazing compound may still feel soft after 3 days to 7 days. Accordingly, sash should be operated carefully for approximately three weeks on the average. Glazing may still be damaged if sash is handled carelessly. Full adhesion will develop within one to two months, depending on job conditions.

Illustration of Key Terminology Used in Face Glazing

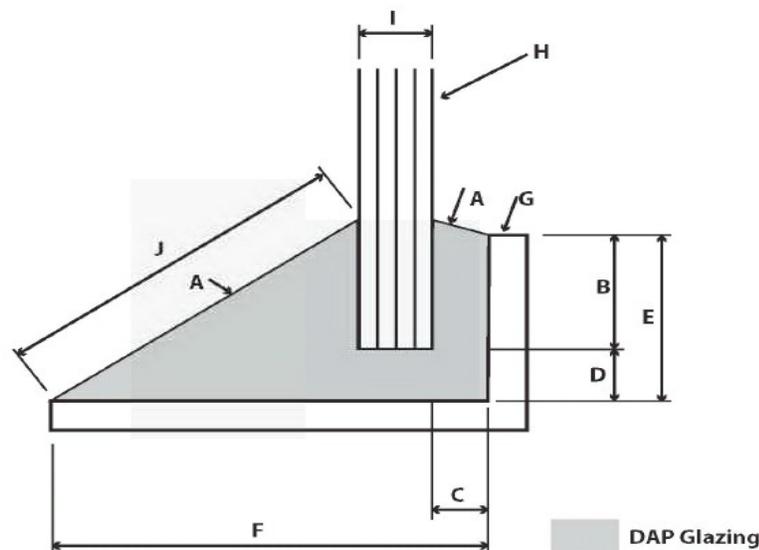

- A - Finish edge of glazing or sealing surface
- B - Bite (dimension by which the framing system overlaps the edge of the lite or glazing infill)
- C - Bed Thickness (minimum 1/8" required)
- D - Edge Clearance (the spacing between the edge of the lite & the bottom of the glazing pocket)
- E - Channel or Rabbet Depth
- F - Channel or Rabbet Width
- G - Fixed Stop (portion of the rabbet to receive glaze bedding & the edge of the lite or glazing infill)
- H - Lite (glass or panel)
- I - Lite Thickness
- J - Face Dimension

NOTE 1: Setting blocks may be required depending on size of glass.

NOTE 2: Spacer shims may be required depending on size of glass.

NOTE 3: Metal spring clips required for metal sash; glazier's points required for wood sash.

NOTE 4: Drawing is not to scale; for illustrative purposes only



TECHNICAL DATA SHEET

2400 Boston Street | Suite 200 | Baltimore, MD | 21224

TYPICAL PHYSICAL & CHEMICAL PROPERTIES

Consistency	Paste
Drying Time	Approx. 3 to 7 days depending on temperature, humidity and fill volume
Vehicle	Synthetic Polymer Latex
Volatile	Water
Solids	88% by weight
Filler	Inorganic Filler
Weight per Gallon	15.2 lbs.
Odour	Slight
Application Temperature	5°C to 32°C (40°F to 90°F)
Service Temperature	-28°C to 71°C (-20°F to 160°F)
Shelf Life	12 months in an unopened container
Coverage	Up to 10 meters at 1 cm x .64 cm triangular cross section. (approximately 5.8 meters including bedding)

CLEAN UP & STORAGE

Clean tools immediately after use with warm water. Dried material must be cut or scraped away. Be sure container is closed and tightly sealed. Store in a cool, dry place.

SAFETY

See product label and Safety Data Sheet (SDS) for health and safety information. You can request an SDS by visiting our website at dap.ca or by calling **888-DAP-TIPS**.



TECHNICAL DATA SHEET

2400 Boston Street | Suite 200 | Baltimore, MD | 21224

WARRANTY

Limited Warranty:

If product fails to perform when used as directed, call 888-DAP-TIPS for replacement product or sales price refund. DAP Canada will not be responsible for incidental or consequential damages.

COMPANY IDENTIFICATION

Manufactured for: DAP Canada, 475 Finchdene Square, Unit 5, Scarborough, ON, M1X 1B7

Usage Information: Call 888-DAP-TIPS or visit dap.ca & click on "Ask the Expert"

Order Information: 800-668-9397 or 416-321-1522 or CanadaOrders@DAP.com

Fax Number: 416-321-3325

Also, visit the DAP website at dap.ca